



## FINAL REPORT

<b>SURVEY</b>	<b>MOORING ROPES INSPECTION</b>
<b>TO</b>	TERMINAL GUACOLDA II
<b>FROM</b>	ALS INSPECTION CHILE SPA.
<b>CLIENT REF</b>	N/A
<b>ALS REF</b>	ANF-2605-1783.
<b>SCOPE OF SURVEY</b>	INSPECTION OF 13 MOORING LINES.
<b>VESSEL NAME</b>	PAN GLOBAL.
<b>OWNER</b>	POS MARITIME ZA S A.
<b>DISPONENT OWNER</b>	STX DALIAN SHIPBUILDING CO., LTD.
<b>CHARTERERS</b>	SWISS MARIME.
<b>PLACE OF SURVEY</b>	HUASCO, BAY.
<b>DATE OF SURVEY</b>	MAY 16, 2026.
<b>TIME OF SURVEY</b>	14:30 HRS. TO 17:45 HRS.

### SUMMARY

From a total of 13 mooring lines inspected:

- 10 COMPLY with the length and visual condition for use.
- 03 mooring ropes rejected for cuts strands and fiber broken.

#### Definitions:

Good : Unimpaired condition without significant wear or deviation from original strength and operating efficiency.

Fair : Condition in which wear and tear and other deficiencies of minor nature not requiring correction or repair

Poor : Condition in which the adequacy of strength and/or operational efficiency is marginally below acceptable limits or is in doubt





1.- SURVEY FINDINGS

1.1.- CHECK LIST OF MOORING ROPE N° 1

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2985971.</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>


Length measured by surveyor: **220,3** meters.

Remarks N/A





1. View of seal N° 2985971.

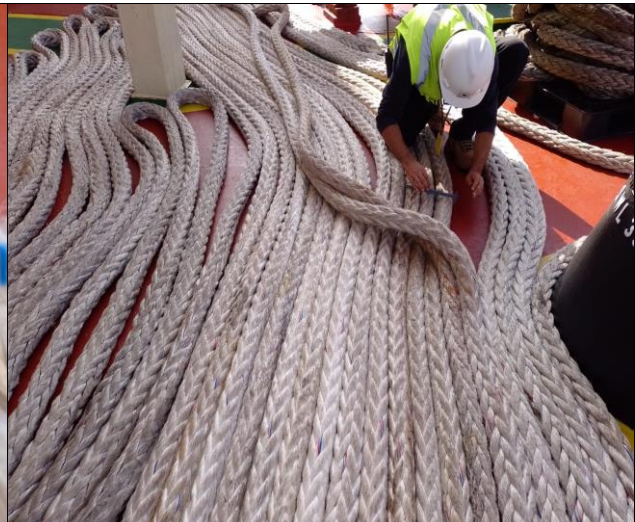

2. General view of the rope.



3. Internal condition of the ropes.



4. Length measured by surveyor.





1.2.- CHECK LIST OF MOORING ROPE N° 2

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2985972.</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,2** meters.

Remarks: N/A





5. View of seal N° 2985972.



6. General view of the rope.



7. Internal condition of the ropes



8.Length measured by surveyor.





### 1.3.- CHECK LIST OF MOORING ROPE N° 3

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2985973.</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220.4** meters.

Remarks: N/A





8. View of seal N°2985973.



9. General view of the rope.



9. Internal condition of the ropes



10. Length measured by surveyor.





1.4.- CHECK LIST OF MOORING ROPE N° 4

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2920738. (REJECTED)</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input type="checkbox"/>	<input type="checkbox"/>	Over 25% <input checked="" type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,5** meters.

Remarks: Rejected ext. abrasion and fiber broken.





11. View of seal N° 2920738.



12. General view of the rope.



13. Internal condition of the ropes.



14. Length measured by surveyor.





1.5.- CHECK LIST OF MOORING ROPE N° 5

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2920711. (REJECTED)</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input type="checkbox"/>	<input type="checkbox"/>	Over 25% <input checked="" type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220.2** meters.

Remarks: Rejected ext. abrasion and fiber broken.





15. View of seal N° 2920711.



16. General view of the rope.



17. Internal condition of the ropes.



18. Length measured by surveyor





1.6.- CHECK LIST OF MOORING ROPE N° 6

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. /HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2985974.</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,9** meters.

Remarks: N/A





19. View of seal N<sup>a</sup> 2985974.



20. General view of the rope.



21. Internal condition of the ropes.



22. Length measure by surveyor.





1.7.- CHECK LIST OF MOORING ROPE N° 7

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2920712. (REJECTED)</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,4** meters.

Remarks: Rejected for cut strands and fiber broken.





23. View of seal N° 2920712.



24. General view of the rope.



25. Internal condition of the ropes



26. Length measure by surveyor.





1.8.- CHECK LIST OF MOORING ROPE N° 8

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	<b>2985975.</b>

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,0** meters.

Remarks: N/A





27. View of seal N° 2985975.



28. General view of the rope.



29. Internal condition of the ropes.



30. Length measured by surveyor.





1.9.- CHECK LIST OF MOORING ROPE N° 9

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	2985976.

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,2** meters.

Remarks: N/A





31. View of seal N° 2985976.



32. General view of the rope.



33. Internal condition of the ropes.



34. Length measured by surveyor.





1.10.- CHECK LIST OF MOORING ROPE N° 10

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	2985977.

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,1** meters.

Remarks: N/A





35. View of seal N° 2985977.



36. General view of the rope.



37. General diameter of the rope.



38. Length measured by surveyor.





1.11.- CHECK LIST OF MOORING ROPE N° 11

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	2985978.

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,0** meters.

Remarks: N/A





11. View of seal N° 2985978.



12. General view of the rope.



13. General diameter of the rope.



14. Length measured by surveyor.





1.12.- CHECK LIST OF MOORING ROPE N° 12

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	2985979.

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,0** meters.

Remarks: N/A





11. View of seal N° 2985979.



12. General view of the rope.



13. General diameter of the rope.



14. Length measured by surveyor.





1.13.- CHECK LIST OF MOORING ROPE N° 13

ALS REFERENCE	ANF-2605-1783.	Date/Time	16/05/2026.
CLIENT	ULTRAMAR		
VESSEL/PLACE	PAN GLOBAL. / HUASCO, CHILE.		
MOORING ROPE NOMINAL LENGHT	220 METERS	SEAL APPLIED	2985980.

According OCIMF standard, letter D.2 / Cordage Institute DIRSOMAR-PROINSP/200/011/2016

DAMAGE ITEM	GOOD	FAIR	POOR
Ext. Abrasion (max 25%)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Over 25% <input type="checkbox"/>
Int. Abrasion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cut strands	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Burn/ heated parts / fusion	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Sun degradation /discoloration	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fiber broken	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Black stains / dirty	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Inconsistent diameter	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Inconsistent flexibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Number of splices	(0) <input checked="" type="checkbox"/>	(1- 2) <input type="checkbox"/>	Discard 3 <input type="checkbox"/>

Length measured by surveyor: **220,1** meters.

Remarks: N/A





11. View of seal N° 2985980.



12. General view of the rope.



13. General diameter of the rope.



14. Length measured by surveyor.





## 2.- COMMENTS

No records or history of previous inspections of the mooring lines were shown, not did the units possess visible or recognizable identification such as plates, sleeves, seals, or permanent marks.

The mooring ropes corresponding to standard ropes. According to information received from Vessel Chief officer the vessel does not use mooring tails.

- 03 mooring ropes rejected for cuts strands and fiber broken.

## 3.- CONCLUSION

From a total of 13 mooring lines inspected, 10 of them comply with the conditions for use.

This survey was carried out without prejudice and in the interest of whom it may concern.

**Daniela Lucero T.**  
**Surveyor**  
**ALS INSPECTION CHILE SPA**

Prepared by: D. Lucero.

Reviewed by: M. Lopez.

Validated by: J. Lopez.

